


MALE CONNECTOR

展毅自動控制有限公司

SAE straight thread boss connects flared tube ends to straight thread boss S.A.E.

TAF

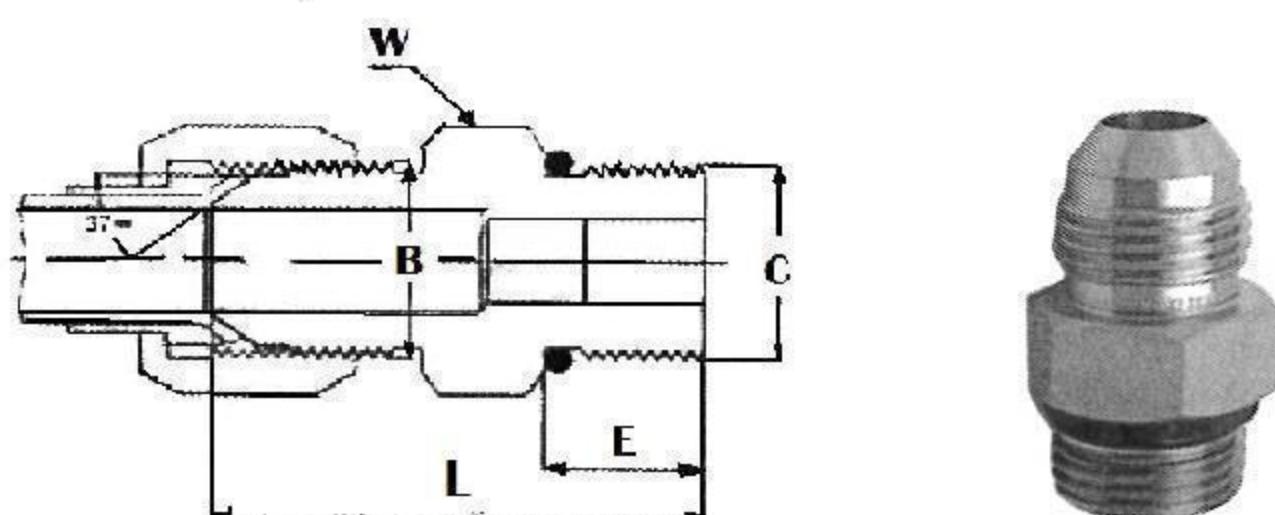

NO.	TUBE O.D	B	C	W	E		L		O-RING STD. Dash NO.
	inch	JIC(AN)	SAE	inch	inch	MM	inch	MM	
TAF 20-5/16	1/8	5/16-24	5/16-24	7/16	0.30	7.5	1.06	26.9	-902
TAF 30-3/8	3/16	3/8-24	3/8-24	1/2	0.30	7.5	1.10	27.9	-903
TAF 40-7/16	1/4	7/16-20	7/16-20	9/16	0.36	9.1	1.23	31.2	-904
TAF 40-1/2	1/4	7/16-20	1/2-20	5/8	0.36	9.1	1.23	31.2	-905
TAF 40-9/16	1/4	7/16-20	9/16-18	11/16	0.39	9.9	1.30	33.0	-906
TAF 40-3/4	1/4	7/16-20	3/4-16	7/8	0.44	11.1	1.37	34.8	-908
TAF 50-1/2	5/16	1/2-20	1/2-20	5/8	0.36	9.1	1.23	31.2	-905
TAF 60-9/16	3/8	9/16-18	9/16-18	11/16	0.39	9.9	1.30	33.0	-906
TAF 60-3/4	3/8	9/16-18	3/4-16	7/8	0.44	11.1	1.38	35.1	-908
TAF 60-7/8	3/8	9/16-18	7/8-14	1	0.50	12.7	1.50	38.1	-910
TAF 80-3/4	1/2	3/4-16	3/4-16	7/8	0.44	11.1	1.48	37.6	-908
TAF 80-9/16	1/2	3/4-16	9/16-18	13/16	0.39	9.9	1.44	36.6	-906
TAF 80-7/8	1/2	3/4-16	7/8-14	1	0.50	12.7	1.60	40.6	-910
TAF 80-1 1/16	1/2	3/4-16	1-1/16-12	1-1/4	0.59	15.1	1.76	44.7	-912
TAF 100-7/8	5/8	7/8-14	7/8-14	1	0.50	12.7	1.70	43.2	-910
TAF 100-3/4	5/8	7/8-14	3/4-16	15/16	0.44	11.1	1.60	40.6	-908
TAF 100-1 1/16	5/8	7/8-14	1-1/16-12	1-1/4	0.59	15.1	1.86	47.2	-912
TAF 120-1 1/16	3/4	1-1/16-12	1-1/16-12	1-1/4	0.59	15.1	1.97	50.0	-912
TAF 120-3/4	3/4	1-1/16-12	3/4-16	1-1/8	0.44	11.1	1.78	45.2	-908
TAF 120-7/8	3/4	1-1/16-12	7/8-14	1-1/8	0.50	12.7	1.83	46.4	-910
TAF 120-1 5/16	3/4	1-1/16-12	1-5/16-12	1-1/2	0.59	15.1	2.00	50.8	-916
TAF 140-1 3/16	7/8	1-3/16-12	1-3/16-12	1-3/8	0.59	15.1	1.99	50.5	-914
TAF 140-1 5/16	7/8	1-3/16-12	1-5/16-12	1-1/2	0.59	15.1	2.02	51.3	-916
TAF 160-1 1/16	1	1-5/16-12	1-1/16-12	1-3/8	0.59	15.1	2.01	51.1	-912
TAF 160-1 3/16	1	1-5/16-12	1-3/16-12	1-3/8	0.59	15.1	2.04	51.8	-914
TAF 160-1 5/16	1	1-5/16-12	1-5/16-12	1-1/2	0.59	15.1	2.04	51.8	-916